

Low Profile Connectors for AC power supply

RP34L Series

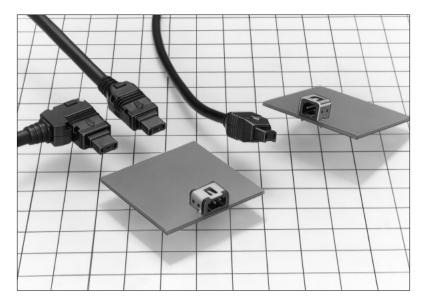

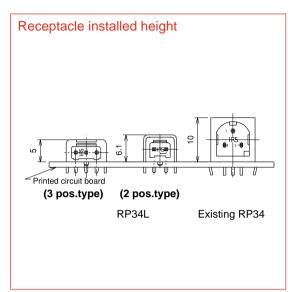

Features

1. Low profile

Receptacles are designed with their installation heights to be shorter than those of conventional RP34 series.

2. Space saving

Both 2 and 3 position receptacles are miniaturized to 7mm length, resulting in a small board mounting area.

3. Snap-lock mechanism

Audible click when connector is fully mated.

4. Precise mated connection

Secure hold of the plug on au 3 axis.

5. Sequence mating

The 3 contact type has sequenced mating. One pin makes contact as a ground terminal before the other contacts.

6. No Mismating


Two polarized keys prevent any insertion error.

7. Ease of Mating

An arrow on the top of the plug shows the proper direction for insertion.


Applications

Notebook PCs, portable remote terminals, AV equipment, etc.

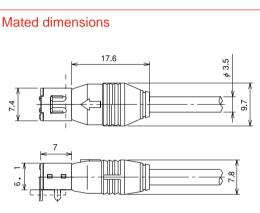

RP34L-5PA-2SC(****) & RP34L-5R-2PD

This 2 contact plug is an over-molded (i.e., cable-integrated form) type. Recommended cable diameter is $3.5 \mathrm{mm}$ dia.

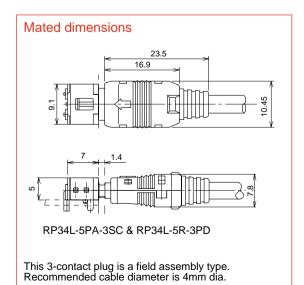

Product Specifications


Ratings	Current rating	5A	Operating temp. range	-25℃~+85℃
	Voltage rating	30V AC, 42A DC	Storage temp. range	-10℃~+60℃

Item	Specification	Conditions
1.Contact resistance	30mΩ or max.	1A DC
2.Insulation resistance	1000mΩ min.	100V DC
3.Withstanding voltage	No flashover or insulation breakdown	150V AC/1 minute
4.Vibration	No electric disconnection of 10µs or more	$10{\sim}55\text{Hz},$ one-sided amplitude 0.75mm, 3 directions for 2hours, respectively
5.Temperature cycle	Insulation resistance:100m Ω min.	-55℃ for 30 min.→normal temp. for 10~15 min.→+85℃ for 30 min.→normal temp. for 10~15 min. 5 cycles
6.Salt spray	No corrosions	5% salt water solution, 48 hours
7.Durability	Contact resistance:60mΩ max.	5,000 mating / un-mating

Material

Component		Material Finish / Color		Remarks	
	Metal comp.	Phosphor bronze	Solder-plating		
2 pos.	Insulator	Nylon	Black	UL94HB	
	Contacts	Brass	Palladium-plating		
	Cover	Vinyl chloride	Black	UL94V-0	
2 pos.	Insulator	Nylon	Black	UL94HB	
	Contacts	Phosphor bronze			
	Metal comp.	Phosphor bronze	Solder-plating		
3 pos.	Insulator	PPS	Black	UL94V-0	
	Contacts	Brass	Palladium-plating		
	Cover	Polycarbonate	Black	UL94V-0	
3 pos.		Vinyl chloride	Black	UL94V-0	
	Insulator	PPS	Black	UL94V-0	
	Contacts	Phosphor bronze	Palladium-plating		


Ordering information

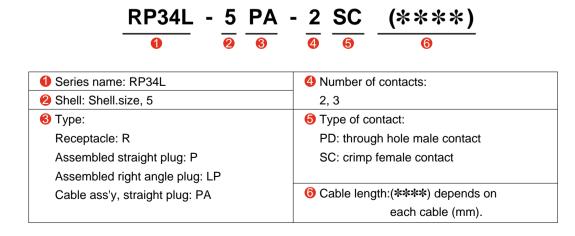



Receptacles 2 pos.


RP34L-5R-2PD











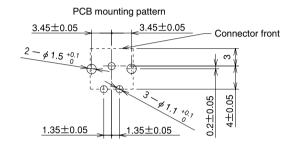





Recommended panel cutout



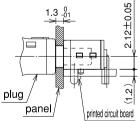



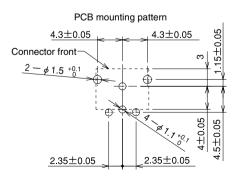


Part Number	CL No.	
RP34L-5R-2PD	113-5154-6-00	
RP34L-5R-3PD	113-5157-4-00	

■Plugs






■RP34L-5LP-3SC

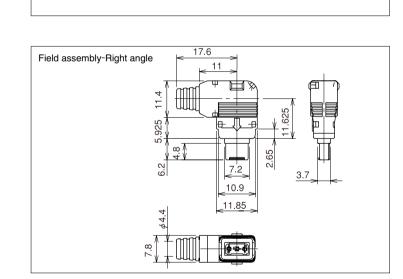

Part Number	CL No.		
RP34L-5PA-2SC(1857)	113-5153-3-00		
RP34L-5P-3SC	113-5158-7-00		
RP34L-5LP-3SC	113-5161-1-00		



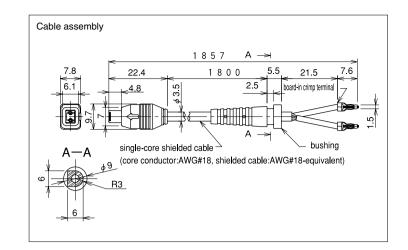

29.7 23.1

4.8

¢∭ ₿

6.2

10.45 7.2 (outer shell)


7.8

Field assembly-Straight

4 **HS**

Crimp contact



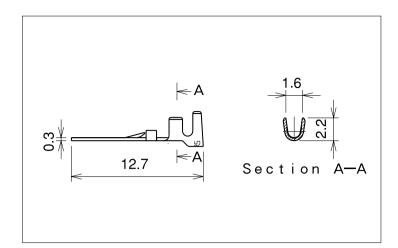


Part Number	CL No.	
RP34L-SC1-212(01)	113-5151-8-01	

Applicable Tools


TYPE		Part Number	CL No.	Conformant terminal	Applicable conductor
Manual crimping tool		HT-102/RP34L-SC1-212		RP34L-SC1-212(01)	AWG#18~#22
Crimper Automatic Crimper body	Automatic	CM-105	901-0005-4		
	Crimper body	AP105-RP34L-SC1-212	901-2043-4	RP34L-SC1-212(01)	AWG#18~#22
Cable crimping tool		RP34-TC-01	150-0074-1		<i>ф</i> 4
Drawing tool		RP6-SC-TP	150-0039-0		

Assembly Instructions(3-Position Plug)

Straight Plug

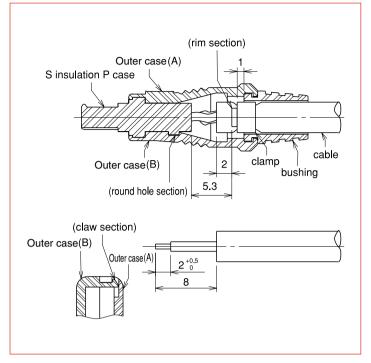

Right Angle Plug

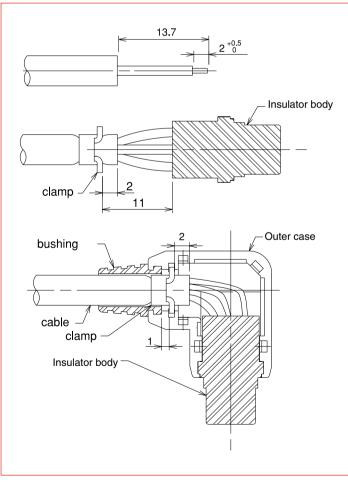


- 1. Slide the bushing over the cable.
- 2. Prepare the cable end and the conductors as shown.
- 3. Crimp the contacts to each conductor. Verify the crimp dimensions.
- 4. Insert each of the contacts into the insulator body. Verify that the contact is secure by slightly pulling on the conductor. Should the contacts require reinsertion, use the tool RP6-SC-TP to remove them (Inserted from the termination side).
- 5. Crimp the cable clamp over the cable at designated dimension (Tool number:RP34-TC-01).
- 6. Place the outer case on a flat surface , with inside facing up.
- 7. Carefully place the insulator body, clamp and the bushing into corresponding indents and cut-outs in the outer case. Verify correct location. (As shown on drawing)
- Note A: When placing all components in the case, exercise caution as NOT to damage any of the protruding snap.
- Note B: All components should fit easily, without use of any force.
- 8. Carefully align the other outer case over all components case. Do not force alignment.
- 9. Snap the case in place.

1. The right angle plug can also be assembled by using the same procedure as the straight plug.

Precautions

1. Use the connector section with its panel held down so as not to have excessive load.For 2-contact type, hold the outer shellsection of the receptacle, and for 3 contact type, the outer shell section of the plug.

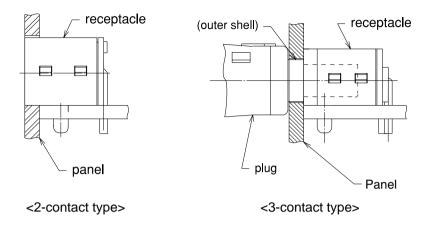

2. After connector assembly, cable must not be pulled over 30N in the arrow-indicated direction. Be careful not to add excessive tensile load because it will lead the damage of connectors.

