TOSHIBA Bipolar Linear Integrated Circuit Silicon Monolithic


TA6038FN

Shock Sensor IC

TA6038FN detects an existence of external shock through the shock sensor and output.

Features

- TA6038FN operates from 2.7 to 5.5 V DC single power supply voltage.
- Signal from the shock sensor is amplified according to setting gain, and is detected through the internal window comparator.
- TA6038FN incorporates 1-ch shock detecting circuitry.
- Input terminal of sensor signal is designed high impedance. Differential input impedance = 100 M Ω (typ.)
- LPF (low pass filter) circuitry is incorporated. Cut-off frequency of LPF = 7 kHz
- Sensitivity of shock detection can be adjusted by external devices.
- Small package SSOP10-P-0.65A (0.65 mm pitch)

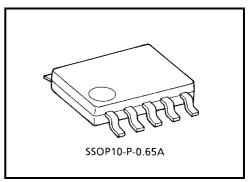


Weight: 0.04 g (typ.)

Block Diagram

C_4 C_1 C₃ R₁ R_2 (9) $50 M\Omega$ OP-AMP **OPAMP** DIFF & LPF ×5 7 kHz Comparator 1.7 V 1.3 V REF 0.9 V Comparator **OPAMP** (3 (5) 50 MΩ C_2

Pin Connection (top view)

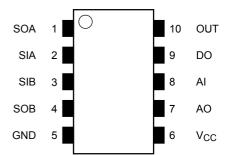

Pin Function

Pin No.	Pin Name	Function
1	SOA	Amp (A) output terminal
2	SIA	Connection terminal of shock sensor
3	SIB	Connection terminal of shock sensor
4	SOB	Amp (B) output terminal
5	GND	Ground terminal
6	V _{CC}	Power supply voltage
7	AO	Op-Amp output terminal
8	Al	Op-Amp input terminal
9	DO	Differential-Amp output terminal
10	OUT	Output terminal (output = "L" when shock is detected.)

Maximum Ratings (Ta = 25°C)

Characteristics	Symbol	Rating	Unit
Power supply voltage	V _{CC}	7	V
Power dissipation	P _D	300	mW
Storage temperature	T _{stg}	-55 to 150	°C

Recommend Operating Condition

Characteristics	Symbol	Rating	Unit
Power supply voltage	V _{CC}	2.7 to 5.5	V
Operating temperature	T _{opr}	-25 to 85	°C

Note: The IC may be destroyed due to short circuit between adjacent pins, incorrect orientation of device's mounting, connecting positive and negative power supply pins wrong way round, air contamination fault, or fault by improper grounding.

Electrical Characteristics (unless otherwise specified, $V_{CC} = 3.3 \text{ V}$, $Ta = 25^{\circ}\text{C}$)

Characteristics	Symbol	Test Circuit	Test Condition	Min	Тур.	Max	Unit
Supply voltage	V _{CC}	_	_	2.7	3.3	5.5	V
Supply ourrent	Icc	(1)	V _{CC} = 3.3 V	_	1.8	2.5	mA
Supply current			V _{CC} = 5.0 V		1.8	2.5	

(DIFF-AMP)

Characteristics		Symbol	Test Circuit	Test Condition	Min	Тур.	Max	Unit
Input impedance	(Note 1)	Zin	_	_	30	100	_	MΩ
Gain		GvBuf	(2)	_	13.6	14	14.4	dB
Output DC voltage		VoBuf	(3)	Connect C = 1000 pF between 1 pin and 2 pin, 3 pin and 4 pin	0.7	1	1.3	V
Low pass filter cut-off freq.		fc	(4)	Frequency at -3dB point	5	7	11	kHz
Output source current		IBso	(5)	Voh = V _{CC} – 1 V	300	800	_	μА
Output sink current		IBsi	(6)	Vol = 0.3 V	75	130	_	μА

Note 1: Marked parameters are reference data.

(OP-AMP)

Characteristics		Symbol	Test Circuit	Test Condition	Min	Тур.	Max	Unit
Cut-off frequency	(Note 1)	fT	_	_	1.5	2	_	MHz
Openloop gain	(Note 1)	Gvo	_	_	80	90	_	dB
Input voltage 1		Vin1	(7)	_	1.235	1.3	1.365	V
Input current		l _{in}	(8)	_	_	25	50	nA
Offset voltage	(Note 1)	Voff	_	_	-5	0	5	mV
Output source current		IAso	(9)	$Voh = V_{CC} - 1 V$	250	800		μА
Output sink current		IAsi	(10)	Vol = 0.3 V	130	200	_	μА

Note 1: Marked parameters are reference data.

(window-comparator)

Characteristics	Symbol	Test Circuit	Test Condition	Min	Тур.	Max	Unit
Trip voltage 1 (Note 1)	Vtrp1	_	_	Vin1 ±0.38	Vin1 ±0.4	Vin1 ±0.42	٧
Output source current	IWso	(11)	$Voh = V_{CC} - 0.5 V$	30	50	_	μА
Output sink current	IWsi	(12)	Vol = 0.3 V	300	800	_	μА

Note 1: Marked parameters are reference data.

Application Note

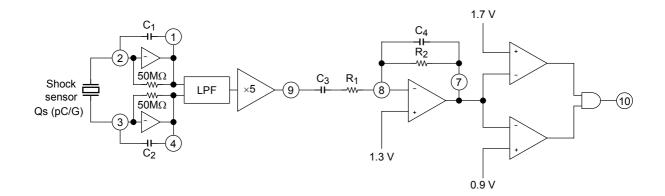


Figure 1 The Configuration of G-Force Sensor Amplifier

Figure 1 shows the configuration of G-Force sensor amplifier. The shock sensor is connected between the pins 2 and 3.

- < How to output 0 or 1 from the pin 10 to detect whether there is a shock or not. >
 - Using a sensor with the sensitivity Qs (pC/G) to detect the shock g (G). -
- a. Setting gain: C1 = C2 (pF), R1 (k Ω), R2 (k Ω)

$$\frac{\text{Qs} \times \text{g}}{\text{C1}} \times 2 \times 5 \times \frac{\text{R2}}{\text{R1}} = 0.4 \text{ (V)}$$

$$C1 = C2 = \frac{Qs \times g}{0.04} \times \frac{R2}{R1}$$

Example: Detecting 5 (G)-shock using a sensor with Qs = 0.34 (pC/G), R1 = 10 (k Ω), R2 = 100 (k Ω).

$$C1 = C2 = \frac{0.34 \times 5}{0.04} \times \frac{100}{10} = 425 \text{ (pF)}$$

b. Setting the frequency (Hz) of HPF: Setting C3 (μ F), R1 ($k\Omega$)

fc (Hz) =
$$\frac{1}{2 \times \pi \times R1 \times C3} \times 10^3$$

Example: Setting the frequency to 20 Hz with $R1 = 10 \text{ (k}\Omega)$.

$$C3 = \frac{1}{2 \times \pi \times 10 \times 20} \times 10^3 = 0.8 \,(\mu F)$$

c. Setting the frequency (kHz) of LPF: Setting C4 (pF), R2 (kΩ)

$$fc (kHz) = \frac{1}{2 \times \pi \times R2 \times C4} \times 10^{6}$$

Example: Setting the frequency to 5 kHz with $R2 = 100 \; (k\Omega)$.

$$C4 = \frac{1}{2 \times \pi \times 100 \times 5} \times 10^6 = 318 \text{ (pF)}$$

- < How to output the voltage according to the shock through the pin 7. >
 - Using a sensor with the sensitivity Qs (pC/G), and assuming the shock sensitivity of the system is Vsystem (mV/G).
- a. Setting gain: C1 = C2 (pF), R1 (k Ω), R2 (k Ω)


$$\frac{Qs}{C1} \times 2 \times 5 \times \frac{R2}{R1} = Vsystem \times 10^{3} \, (mV/G)$$


$$C1 = C2 = \frac{Qs}{Vsystem} \times \frac{R2}{R1} \times 10^4 (pF)$$


Example: Designing the system with 200 (mV/G) by using a sensor that Qs = 0.34 (pC/G), R1 = 10 (k Ω), R2 = 100 (k Ω).

$$C1 = C2 = \frac{0.34}{200} \times \frac{100}{10} \times 10^4 = 170 \text{ (pF)}$$

Equivalent Circuit

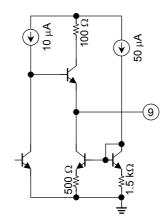

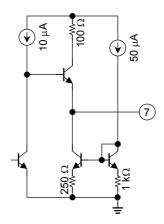


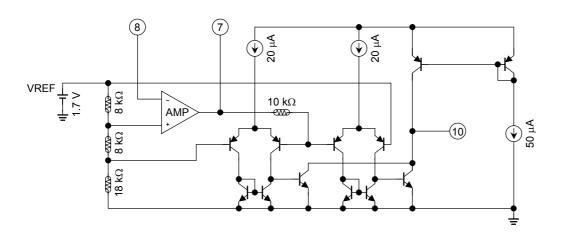


5 2002-02-13

Test Circuit


(1) Supply current ICC

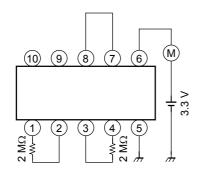


(2) DIFF-AMP Gain **GvBuf** Step 1

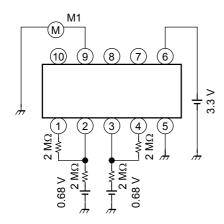


(3) DIFF-AMP Output DC voltage **VoBuf**

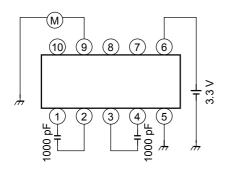


Step 2

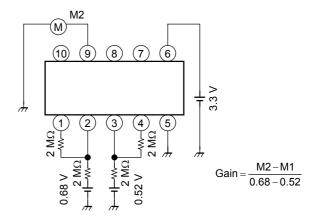


(4) DIFF-AMP Low pass filter cut-off freq. **fc**

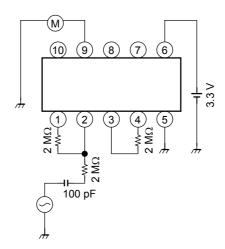


(5) DIFF-AMP Output source current **IBso**

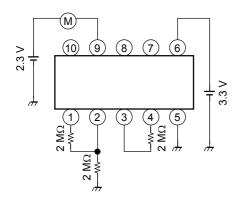


(6) DIFF-AMP Output sink current **IBsi**

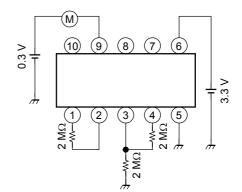


(7) OP-AMP Input voltage 1 **Vin1**

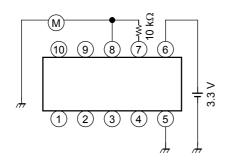


(8) OP-AMP
Input current **I**in

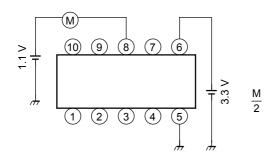


(9) OP-AMP Output source current **IAso**

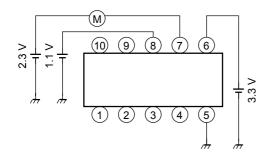

(10) OP-AMP Output sink current **IAsi**

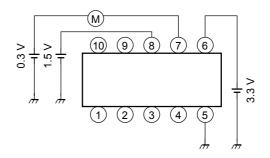


- (11) Window comparator Output source current **IWso**
- (12) Window comparator Output sink current **IWsi**

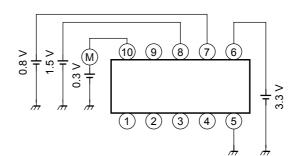


Test Circuit (for reference)


(a) DIFF-AMP **CMRR**

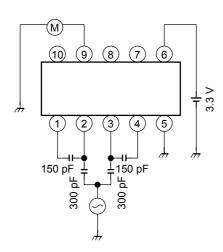

(b) DIFF-AMP **PSRR**

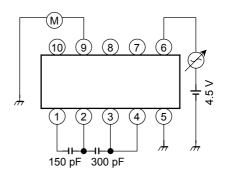

Package Dimensions

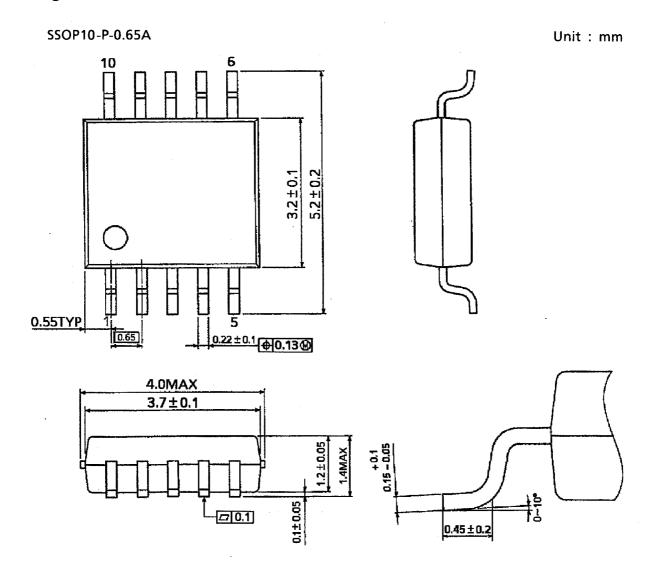

9

Weight: 0.04 g (typ.)

RESTRICTIONS ON PRODUCT USE

000707EAA

- TOSHIBA is continually working to improve the quality and reliability of its products. Nevertheless, semiconductor devices in general can malfunction or fail due to their inherent electrical sensitivity and vulnerability to physical stress. It is the responsibility of the buyer, when utilizing TOSHIBA products, to comply with the standards of safety in making a safe design for the entire system, and to avoid situations in which a malfunction or failure of such TOSHIBA products could cause loss of human life, bodily injury or damage to property.
 In developing your designs, please ensure that TOSHIBA products are used within specified operating ranges as set forth in the most recent TOSHIBA products specifications. Also, please keep in mind the precautions and conditions set forth in the "Handling Guide for Semiconductor Devices," or "TOSHIBA Semiconductor Reliability Handbook" etc..
- The TOSHIBA products listed in this document are intended for usage in general electronics applications (computer, personal equipment, office equipment, measuring equipment, industrial robotics, domestic appliances, etc.). These TOSHIBA products are neither intended nor warranted for usage in equipment that requires extraordinarily high quality and/or reliability or a malfunction or failure of which may cause loss of human life or bodily injury ("Unintended Usage"). Unintended Usage include atomic energy control instruments, airplane or spaceship instruments, transportation instruments, traffic signal instruments, combustion control instruments, medical instruments, all types of safety devices, etc.. Unintended Usage of TOSHIBA products listed in this document shall be made at the customer's own risk.
- The information contained herein is presented only as a guide for the applications of our products. No
 responsibility is assumed by TOSHIBA CORPORATION for any infringements of intellectual property or other
 rights of the third parties which may result from its use. No license is granted by implication or otherwise under
 any intellectual property or other rights of TOSHIBA CORPORATION or others.
- The information contained herein is subject to change without notice.